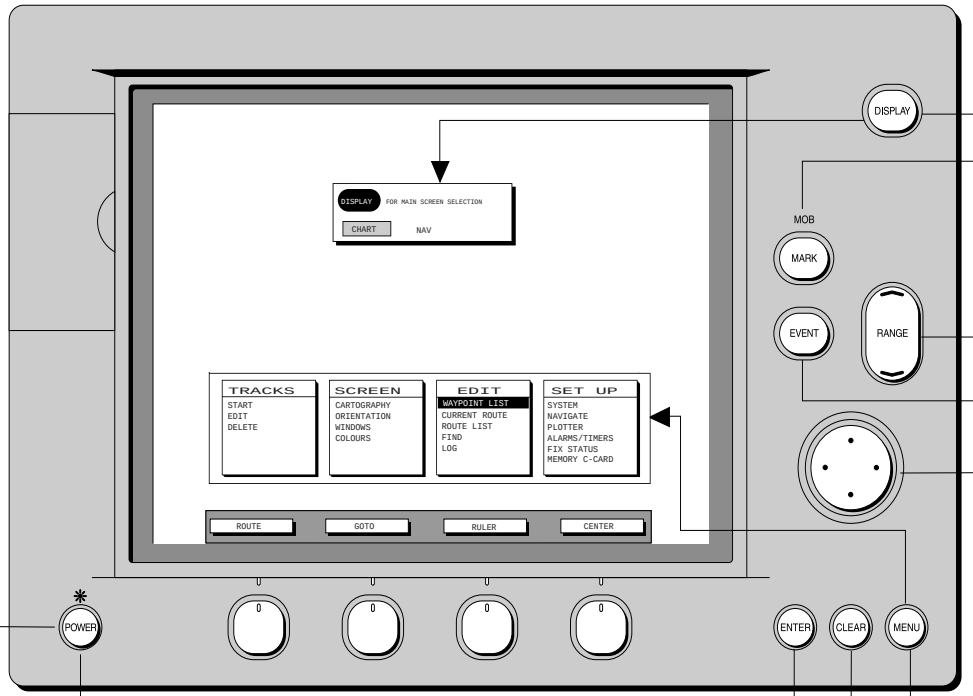

DISPLAY
Press to display current main screen mode.
Press to toggle the main screen modes, and use the soft keys to select the required window or a full-screen display.
The display times out to the normal display.
Press and hold for 5 seconds to print the current display

MARK
Press to display Mark soft keys
Choose Mark symbol.
Press PLACE MARK to place the mark symbol at the cursor position.
Press EXIT to finish.

MOB
Press and hold for 2 seconds to activate or cancel Man Overboard.

PLACE MARK | SELECT SYMBOL | DELETE MARK | EXIT

Chart range scale control
Press the top of the key to zoom out to a smaller-scale chart.
Press the bottom of the key to zoom in to a larger-scale chart.
Press and hold to change the scale faster.

EVENT
Press to display Event soft keys
Choose Event symbol.
Press PLACE EVENT to place event symbol at the vessel's position.
Press EXIT to finish.

PLACE EVENT | SELECT SYMBOL | DELETE EVENT | EXIT

Trackpad
Press the edge to move the cursor on the chart or in the menus

POWER
Press to turn on the display.
Press to access lighting control.
Press for 3 seconds to turn off the display.

Soft keys
Press to select the indicated function, or scroll round a menu list.
If no labels are displayed, press any soft key to display the default soft key labels.
Labels change when you press a dedicated key, as shown above the keys.

MENU
Press to display the Main Menus, with the last-used option highlighted. Use the soft keys or trackpad to highlight the required option, and press ENTER.
Press CLEAR to finish.

ENTER
Press to confirm a selection and (if appropriate) clear the current soft key labels. The key either performs the selected task, accepts changes, or leads to a display of further options.

CLEAR
Press to cancel an operation or display, and return to the previous display.

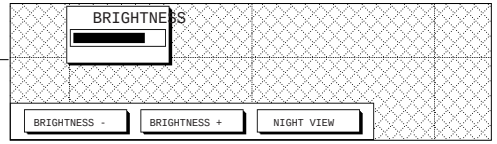

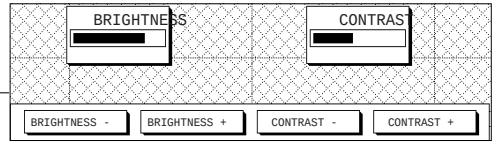

RayChart 620 and 630 Quick Reference Guide

86043_1